




Product Repair Bulletin

P/N 3826042-1/-2

Compressor Housing

NHA: GTCP 36-100 Series APU

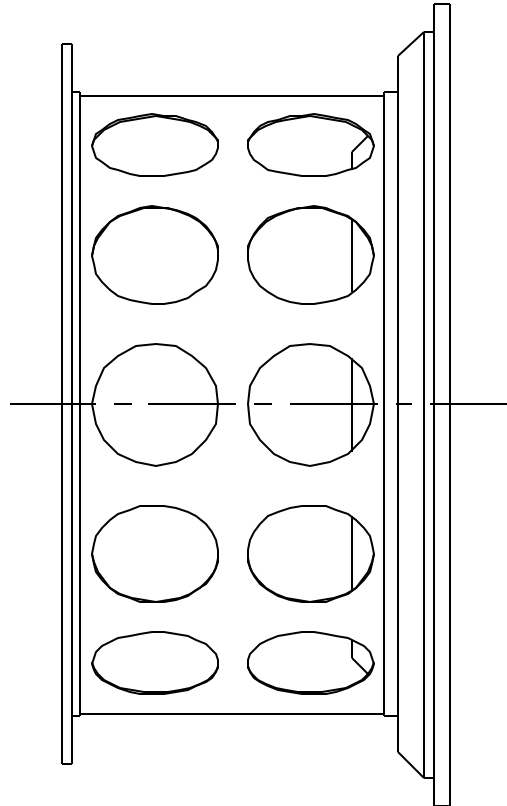

OEM Manual Repairs

Repairs for OEM Manual 49-23-99:

- Repair dents by straightening as necessary.
- Repair cracked or broken welds.
- Repair dimension B (surface A) by metal spray.
- Lap surface G to achieve parallelism to surface D.
- Repaint as necessary.



Product Repair Bulletin

P/N 3826042-1/-2

Compressor Housing

