




Product Repair Bulletin

P/N 695709/899323/695142

3604991/696553

Combustor Cap Assembly

NHA: GTCP85 Series APU

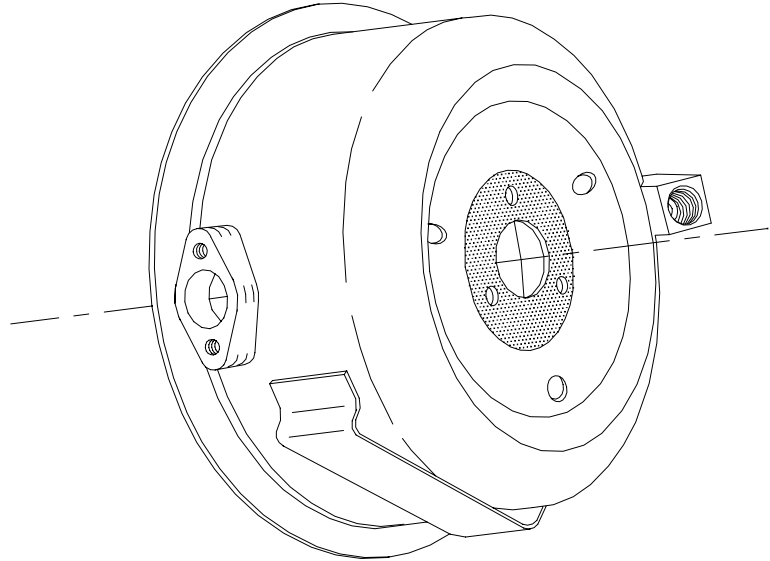

OEM Manual Repairs

Repairs for OEM Manual 49-21-73:

Cold straighten and size igniter location.

Weld/dress cracks.

Fabricate/install -20 center plate.

Additional FAA Approved Repairs

Repairs for Britt Metal Major Repair 9107244:

Fabricate/install -11 I.D. plate.

Fabricate/install -10 boss. (695142 only)

Product Repair Bulletin

P/N 695709/899323/695142

3604991/696553

Combustor Cap Assembly

